


Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-264	Smoke	9/2/2009	ADS/TM	S09MM1015MH	Dry	Yes	1,879.78

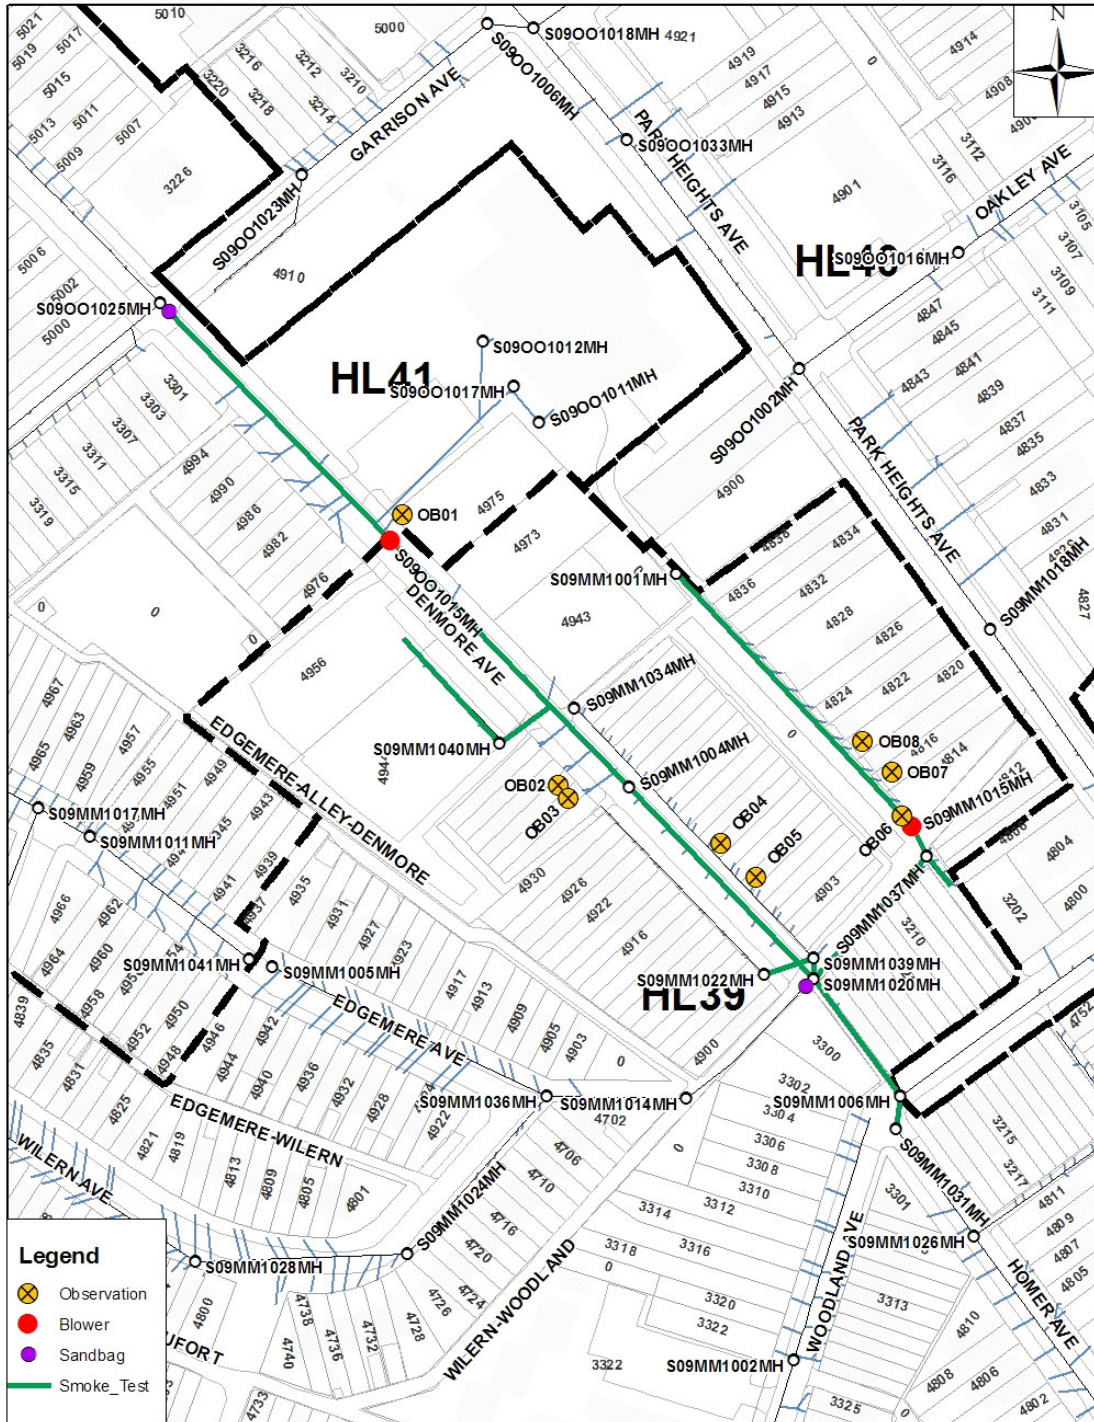

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-264	Smoke	9/2/2009	ADS/TM	S09MM1015MH	Dry	Yes	1,879.78

Isolated Pipes

Pipe ID	Upstream MH	Downstream MH	Length (ft)	Diameter (In)
S09MM1043G1	S09MM1043DE	S09MM1047UN	136.937	8
S09MM1047G1	S09MM1047UN	S09MM1046UN	56.4269	8
S09OO1015G1	S09OO1015MH	S09MM1004MH	325.424	15
S09MM1004G1	S09MM1004MH	S09MM1020MH	252.836	15
S09MM1039G1	S09MM1039MH	S09MM1020MH	19.9253	8
S09MM1020G1	S09MM1020MH	S09MM1006MH	138.215	15
S09MM1006G1	S09MM1006MH	S09MM1031MH	31.6948	18
S09MM1037G1	S09MM1037MH	S09MM1020MH	158.169	8
S09MM1015G1	S09MM1015MH	S09MM1037MH	31.7162	8
S09MM1001G1	S09MM1001MH	S09MM1015MH	328.475	8
S09MM1042G1	S09MM1042DE	S09MM1037MH	35.9648	8
S09OO1025G1	S09OO1025MH	S09OO1015MH	314.017	15
S09MM1022G1	S09MM1022MH	S09MM1039MH	49.9838	8

Observations & Photos

Obs_ID S1028-264-OB01

Address 4975 Denmore Ave


Status Private

Source Cleanout

Location Yard - front

Nearest MH S09OO1015MH

Comments Smoke from cleanout in front yard. 4975 Denmore Ave.

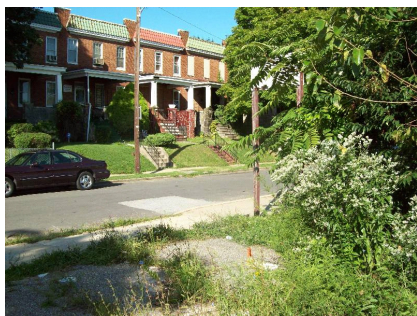

Picture \S1028-264-OB01-P01.jpg

Comments Front yard, 4975 Denmore Ave.



Monday, October 19, 2009

Page 2 of 4

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-264	Smoke	9/2/2009	ADS/TM	S09MM1015MH	Dry	Yes	1,879.78

Obs_ID S1028-264-OB02

Address 4936 Denmore Ave

Status Private

Source Cleanout

Location Yard - front

Nearest MH S09MM1004MH

Comments Smoke from cleanout in front yard. 4936 Denmore Ave.



Picture \S1028-264-OB02-P01.jpg

Comments Front of house, 4936 Denmore Ave.

Obs_ID S1028-264-OB04

Address 4917 Denmore Ave

Status Private

Source Cleanout

Location Field / woods

Nearest MH S09MM1004MH

Comments Smoke from cleanout in empty lot. 4917 Denmore Ave.



Picture \S1028-264-OB04-P01.jpg

Comments Front of lot, 4917 Denmore Ave.

Obs_ID S1028-264-OB03

Address 4934 Denmore Ave


Status Private

Source Cleanout

Location Yard - front

Nearest MH S09MM1004MH

Comments Smoke from cleanout in front yard. 4934 Denmore Ave.

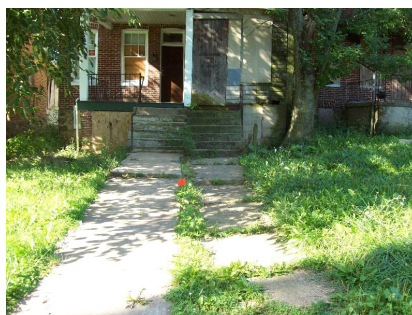

Picture \S1028-264-OB03-P01.jpg

Comments Front of house, 4934 Denmore Ave.

Obs_ID S1028-264-OB05

Address 4911 Denmore Ave

Status Private

Source Cleanout

Location Field / woods

Nearest MH S09MM1039MH

Comments Smoke from cleanout in empty lot. 4911 Denmore Ave.



Picture \S1028-264-OB05-P01.jpg

Comments Front of lot, 4911 Denmore Ave.

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-264	Smoke	9/2/2009	ADS/TM	S09MM1015MH	Dry	Yes	1,879.78

Obs_ID S1028-264-OB06

Address 4814 Park Heights Ave

Status Public

Source Sanitary Manhole

Location Paved concrete

Nearest MH S09MM1015MH

Comments Smoke from sanitary manhole S09MM1015MH (vented cover) in paved concrete behind 4814 Park Heights Ave.



Picture \S1028-264-OB06-P01.jpg

Comments Back of lot, 4814 Park Heights Ave.

Obs_ID S1028-264-OB08

Address 4820 Park Heights Ave

Status Private

Source Service Lateral

Location Yard - back

Nearest MH S09MM1015MH

Comments Smoke from service lateral in back yard. 4820 Park Heights Ave.



Picture \S1028-264-OB08-P01.jpg

Comments Back of house, 4820 Park Heights Ave.

Obs_ID S1028-264-OB07

Address 4816 Park Heights Ave


Status Private

Source Cleanout

Location Yard - back

Nearest MH S09MM1015MH

Comments Smoke from cleanout in back yard. 4816 Park Heights Ave.

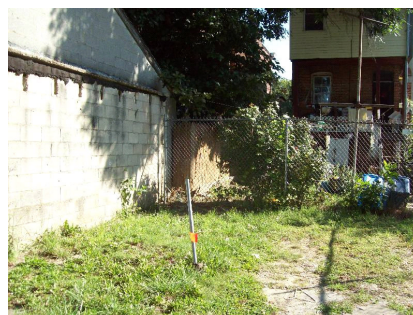

Picture \S1028-264-OB07-P01.jpg

Comments Back of house, 4816 Park Heights Ave.